Division of Health Service Regulation STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION IDENTIFICATION NUMBER: COMPLETED A. BUILDING: 01 FCL009008 B. WING 05/22/2015 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 583 SASAFRAS ROAD DAK GROVE FAMILY CARE HOME BLADENBORO, NC 28320 SUMMARY STATEMENT OF DEFICIENCIES 0X40 ID PROVIDER'S PLAN OF CORRECTION (0.05)(EACH DEFICIENCY MUST BE PRECEDED BY FULL PREFIX (EACH CORRECTIVE ACTION SHOULD BE PREFIX COMPLETE TAG REGULATORY OR LSC IDENTIFYING INFORMATION) CROSS-REFERENCED TO THE APPROPRIATE TAG DATE DEFICIENCY C 000 Initial Comments C 000 Report by Suzanna Fay CONSTRUCTION SECTION DHSR Construction Section conducted a Biennial Survey on May 22, 2015 from 8:24 AM to 9:35 AM at the above referenced facility. DHSR JUL 0 7 2015 records indicate the home was first licensed on June 15, 1984 as a Family Care Home for six RECEIVED ambulatory Residents (able to evacuate and respond without any physical or verbal assistance during a fire or other emergency). Based on this information we are requiring the home to maintain compliance with the following: the 1984 Family Care Homes Minimum Standards and Regulations, applicable portions of the 2005 Rules 10A NCAC 13G for Family Care Homes and the 1978 (Revision 5) North Carolina State Building Code - Section 409.1 (g) - Residential Care Facilities. At the time of our visit, we cited deficiencies that require an acceptable plan of correction. They are as follows: C 117 Have Current San. And Fire Safety Approvals C 117 SECTION .0300 - THE BUILDING 10A NCAC 13G .0302 DESIGN AND CONSTRUCTION (n) The home shall have current sanitation and Complet on 7-2.15 fire and building safety inspection reports which shall be maintained in the home and available for review. This Rule is not met as evidenced by: Based on review of documents, the last Fire Inspection performed at the facility was March 17, 2014. Fire Inspections are required to be conducted annually. Contact the local fire official to schedule an Inspection. Provide a copy of the Sivision of Health Service Regulation ABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE 0085 DATE STATE FORM

> ر ان

FORM APPROVED Division of Health Service Regulation STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION IDENTIFICATION NUMBER: COMPLETED A. BUILDING: 01 B. WING FCL009008 05/22/2015 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 583 SABAFRAS ROAD OAK GROVE FAMILY CARE HOME BLADENBORO, NC 28320 SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (X5) COMPLETE (X4) ID: ID: (EACH DEFICIENCY MUST BE PRECEDED BY FULL (EACH CORRECTIVE ACTION SHOULD BE PREFIX PREFIX DATE REGULATORY OR LSC IDENTIFYING INFORMATION) CROSS-REFERENCED TO THE APPROPRIATE TAG TAG DEFICIENCY C 117 Continued From page 1 C 117 approved report to DHSR/Construction Section. C 153 C 153 Houskeeping And Furnishings-Clean, Repaired SECTION .0300 - THE BUILDING 10A NCAC 13G .0315 HOUSEKEEPING AND FURNISHINGS (a) Each family care home shall: have walls, ceilings, and floors or floor coverings kept clean and in good repair. (2) have no chronic unpleasant odors; (3) have furniture clean and in good repair; (e) This Rule shall apply to new and existing. homes. This Rule is not met as evidenced by: In Bedroom #4, it was observed that a window on the back wall had been removed. The wells were taped and mudded, but have not been painted. The curtain brackets were still mounted above the old opening. Have a qualified person complete the repairs to the wall. C 168 Fire Extinguishers C 168 SECTION .0300 - THE BUILDING 10A NCAC 13G .0316 FIRE SAFETY AND DISASTER PLAN (a) Fire extinguishers shall be provided which meet these minimum regulrements in a family care home: one five pound or larger (net charge) "A-B-C" type centrally located; (2) one five pound or larger "A-B-C" or CO/2 type located in the kitchen; and (3) any other location as determined by the code enforcement official.

This Rule is not met as evidenced by:

FORM APPROVED Division of Health Service Regulation STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION IDENTIFICATION NUMBER: COMPLETED A. BUILDING: 01 B. WING FCL009008 05/22/2016 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 583 SASAFRAS ROAD OAK GROVE FAMILY CARE HOME BLADENBORO, NC 28320 SUMMARY STATEMENT OF DEFICIENCIES. (X4) ID PROVIDER'S PLAN OF CORRECTION (2055) (EACH DEFICIENCY MUST BE PRECEDED BY FULL PREFIX (EACH CORRECTIVE ACTION SHOULD BE PREFIX COMPLETE TAG REGULATORY OR LSC IDENTIFYING INFORMATION) DATE CROBS-REFERENCED TO THE APPROPRIATE TAG DEFICIENCY) C 168 / Continued From page 2 C 168 Observations revealed that the fire extinguishers were last serviced in February of 2014 and are past due for their annual inspection. Have a qualified person inspect and tag the fire extinguishers. C 174 Building Equipment Maintained Safe, Operating. C 174 SECTION .0300 - THE BUILDING 10A NCAC 13G .0317 BUILDING SERVICE EQUIPMENT (a) The building and all fire safety, electrical, mechanical, and plumbing equipment in a family care home shall be maintained in a sefe and operating condition. (j) This Rule shall apply to new and existing family care homes. This Rule is not met as evidenced by: At the time of this survey, the smoke detector. outside of the staff bedroom was hanging from its wires. When the smoke detector was sprayed with canned smoke, the alarm was barely audible. Have a qualified person repair or replace the smoke detector. Provide documentation of the repairs. 2. At the time of this survey, the smoke detector on the Resident hall nearest the living room was not interconnected to the other smoke detectors in the facility. Have a qualified person repair or replace the smoke detector so that when any one detector is activated, all of the detectors sound. Provide documentation of the repairs. At the time of this survey, the smoke detectors in Bedroom #1 and in Bedroom #4 were not

Division of Health Service Regulation

interconnected to the other smoke detectors in the facility. Have a qualified person repair or

Division of Health Service Regulation STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY COMPLETED IDENTIFICATION NUMBER: AND PLAN OF CORRECTION A. BUILDING: 01 B. WING 05/22/2015 FCL009008 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 583 SASAFRAS ROAD OAK GROVE FAMILY CARE HOME BLADENBORO, NC 28320 SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (X4) ID /EACH CORRECTIVE ACTION SHOULD BE COMPLETE EACH DEFICIENCY MUST BE PRECEDED BY FULL PREFIX PREFIX REGULATORY OR LSC IDENTIFYING INFORMATION) CROSS-REFERENCED TO THE APPROPRIATE TAG TAG DEFICIENCY) C 174 C 174 | Continued From page 3 replace the smoke detector so that when any one detector is activated, all of the detectors sound. Provide documentation of the repairs. Observations revealed that the exterior outlet Complet on 7.2.15 on the front porch did not have power. Have a qualified technician repair or replace the outlet. Provide documentation of the repairs. Observations revealed that the latch on the window in Bedroom #3 was broken. Have a qualified person repair the window. Provide documentation of the repairs. 6. Observations revealed that the light in the master bath did not have a globe. Have a qualified person install a globe. Provide documentation of the repairs. Observations revealed the the exhaust fan in the master bath was clogged with dust. Clean the fan and provide verification that the correction is complete. Observations revealed that the kitchen range hood was dirty and the grease filter was missing. Have a qualified person install a grease filter and clean the range hood. Provide documentation of the repairs. Complet on 1.2.15 Observations revealed that one of the flaps at the exterior dryer cap had broken off leaving an opening for pests to enter. Have a qualified person replace the dryer cap. Provide documentation for the repairs. 10. Observations revealed that the metal roof of the carport at the corner of the utility room was damaged. Have a qualified person repair the roof. Provide documentation of the repairs.

Division of Health Service Regulation

STATE FORM

OQ2X21

Division of Health Service Regulation (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY STATEMENT OF DEFICIENCIES COMPLETED AND PLAN OF CORRECTION IDENTIFICATION NUMBER: A. BUILDING: 01 MNG 05/22/2016 FCL009008 STREET ADDRESS, CITY, STATE, ZIP CODE NAME OF PROVIDER OR SUPPLIER 583 SASAFRAS ROAD OAK GROVE FAMILY CARE HOME BLADENBORO, NC 28320 PROVIDER'S PLAN OF CORRECTION SUMMARY STATEMENT OF DEFICIENCIES (X5) COMPLETE (X4) ID (EACH CORRECTIVE ACTION SHOULD BE (EACH DEFICIENCY MUST BE PRECEDED BY FULL PREFIX PREFIX CROSS-REFERENCED TO THE APPROPRIATE REGULATORY OR LSC IDENTIFYING INFORMATION) TAG TAG DEFICIENCY) C 101 C 101 Construction-Single Family IV. The Building B. General Construction and Maintenance (10NCAC 42C .2102) 1. The home must meet the single family residential building code requirements of North Carolina Insurance Department. In addition, the following apply to facilities licensed after February 1, 1983, facilities which increase bed capacity, and facilities which change ownership. This Rule is not met as evidenced by: 1. At the time of this survey the following observations were made: The facility has an addition that is not internally connected. b. The addition has a separate drive and a red pickup truck was parked in the drive. Lawn chairs, coolers and other miscellaneous items were sitting in front of the main entry to the addition. Per interview with Staff, she stated that most of the items were hers. Interview with Staff indicated that the building was once used as office space and storage, but was currently not being used. e. The porch light was on and one of the window A/C units was running in the addition. The facility has a dryer connection and per interview with Staff it also has a small kitchen which she said was no longer used. g. The addition is not separated by a fire wall and would, therefore, be classifled as part of the family care home. The facility is classified as a single family dwelling. and, therefore, cannot have renters or boarders. Verify that the addition is not being used for rent

OQ2X21

Division	of Health Service Re				WAY DATE ST	IDVEY					
STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA		(X2) MULTIPLE CONSTRUCTION		(X3) DATE SURVEY COMPLETED							
AND PLAN	AND PLAN OF CORRECTION IDENTIFICATION NUMBER:		A. BUILDING: 01								
		FCL009008	B. WNG ,		05/22	/2015					
NAME OF	DOMINED OR SUPPLIED	STREET AD	DRESS, CITY, 5	STATE, ZIP CODE							
NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 683 SASAFRAS ROAD											
OAK GR	OVE FAMILY CARE H	CAMIE	BORO, NC 2								
			,	PROVIDER'S PLAN OF CORRECTION	ON	(X.5)					
(X4) ID PREFIX	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)		PREFIX	(EACH CORRECTIVE ACTION SHOULD BE		COMPLETE					
TAG			YAG	CROSS-REFERENCED TO THE APPRO DEFICIENCY)							
		- VARIABLE		DE IGENOT/							
C 119	Continued From pa	age 6	C 119								
	bathroom did not have a hand grip for the tub. Have a qualified person install a hand grip at the										
	tub. Provide docur	mentation of the repairs.									
C 123	3 Outside Entrances/Exits		C 123								
					1						
1	IV. The Building										
	C. Physical Environment 8. Outside Entrances/Exits (10 NCAC 42C			1							
					ĺ						
	.2209)										
	All floor levels must have at least two exits. If										
Ì	there are only two, the exits must be as remote from each other as reasonably possible. b. At least one entrance/exit door must be a minimum clear width of three feet and another must be a minimum clear width of two feet and										
					İ						
	eight inches.										
		side entrances/exits for the									
		el must be at ground level or									
		with a 1 inch rise for each 12 the ramp. If there are only two	1								
		e entrances/exits must be as									
		other as reasonably possible.									
		or the ramp at exits not at									
		s to homes which have at least									
	one resident who n	needs personal assistance in									
	getting up or down		1								
		ks must be easily operable, by									
•		on, from the inside at all times	1								
ļ	without keys.	dt must be free of all									
		pediments to allow for full									
		of fire or other emergency.									
		es, stoops and ramps must be									
		Irails and guardrails.									
	This Bule is set as	at an auddamand to:		Complets on 7	لأدي	-					
		et as evidenced by: evealed that the kitchen exit		Complete m 7	.2-12	,					
		single action. Have a qualified		W year	.						
	I WICHARC MOS HOL	augus avenus i lava a dudilliga	1	,							

911

Division of Health Service Regulation

AND PLAN OF CORRECTION		IDENTIFICATION NUMBER:	A. BUILDING: 01		(X3) DATE SURVEY COMPLETED						
FCI		FCL009008	B. WING		05/22/2015						
		DRESS, CITY,	STATE, ZIP CODE								
OAK GROVE FAMILY CARE HOME 583 SASAFRAS ROAD											
BLADENBORO, NC 28320											
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)		PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOUL CROSS-REFERENCEO TO THE APPROVIDENCY)	D BE COMPLETE						
C 123	Continued From page 7		C 123								
	action hardware. Prepairs.	door hardware with single rovide documentation of the yealed a set of steps from the									
	sliding door exit out did not have handra	of the living room. The steps ills. Have a qualified person either side of the steps.									
C 125	Floors		C 125								
	material and so concleanable. b. Scatter or throw										
		observed on the floor in we all of the throw rugs.									
	#3 was badly stained	realed the carpet in Bedroom d. Have a qualified person flooring in Bedroom #3. ion of the repairs.									
	Bedroom #2 was bu stained. Have a qua	ealed that the carpet in nching and was badly slifted person replace the om. Provide documentation									
		ealed that the door to the hall ged. The floor finish had not		•							

Division of Health Service Regulation FORM APPROVED STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION AND PLAN OF CORRECTION (X3) DATE SURVEY IDENTIFICATION NUMBER: A. BUILDING: 01 COMPLETED FCL009008 B. WNG _ 05/22/2015 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 583 SASAFRAS ROAD OAK GROVE FAMILY CARE HOME BLADENBORO, NC 28320 SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (EACH DEFICIENCY MUST BE PRECEDED BY FULL PREFIX PREFIX (EACH CORRECTIVE ACTION SHOULD BE REGULATORY OR LSC IDENTIFYING INFORMATION) TAG COMPLETE CROSS-REFERENCED TO THE APPROPRIATE TAG DATE DEFICIENCY C 101 | Continued From page 5 C 101 or boarding. C 119 Bathroom C 119 IV. The Bullding C. Physical Environment Bathroom (10 NCAC 42C .2206) Facilities licensed as of April 1, 1984 must have one full bathroom for each five or fewer persons including live-in staff and family. b. If there is a question whether a home licensed before April 1, 1984 has a sufficient number of bathrooms, the Division of Facility Services is responsible for determining the size and number of bathrooms required based on the number of persons living in the home. The bathroom(s) must be designed to provide privacy. A bathroom with more than one toilet or tub/shower must have privacy partitions or curtains. d. Entrance to the bathroom is not to be through a kitchen, another person 's bedroom, or another e. The bathroom must be located as conveniently as possible to the resident 's bedrooms. Hand grips must be installed at all commodes, tubs and showers on the floor level used by the residents. Nonskid surfacing or strips must be installed. In showers and bath areas. h. The bathroom must be well lighted and adequately ventilated. The bathroom floor must have a non-slippery water-resistant covering. This Rule is not met as evidenced by: Observations revealed that the Residents' hall

OQ2X21

Division of Health Service Regulation STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION IDENTIFICATION NUMBER: COMPLETED A. BUILDING: 01 FCL009008 B. WING. 05/22/2015 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, 2IP CODE 683 SASAFRAS ROAD OAK GROVE FAMILY CARE HOME BLADENBORO, NC 28320 SUMMARY STATEMENT OF DEFICIENCIES (X4) ID PROVIDER'S PLAN OF CORRECTION ΙD (XS) COMPLETE (EACH DEFICIENCY MUST BE PRECEDED BY FULL PREFIX PREFIX (EACH CORRECTIVE ACTION SHOULD BE TAG REGULATORY OR LSC IDENTIFYING INFORMATION) CROSS-REFERENCED TO THE APPROPRIATE DATE TAG DEFICIENCY) C 125 | Continued From page 8 C 125 been repaired where the wall was cut back. Have a qualified person repair the floor finish. Provide documentation of the repairs.

Division of Health Service Regulation